
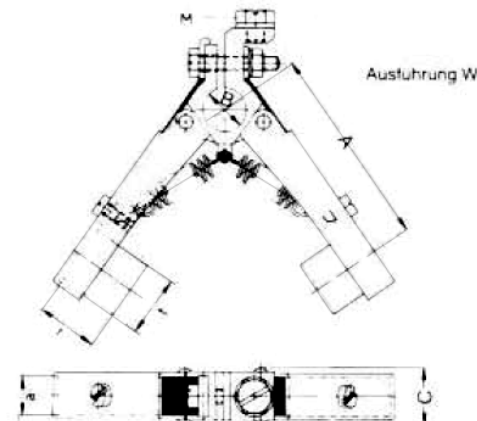


BORSTHÅLLARE Typ DD

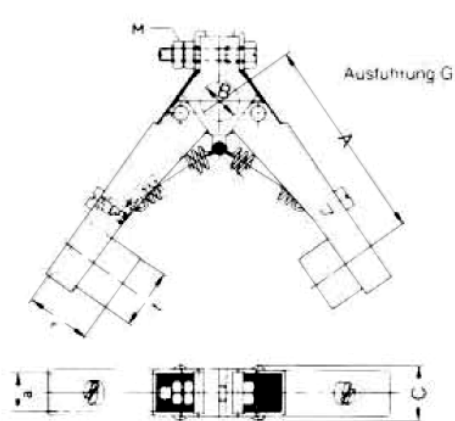

| Bestell-Nr | Bürstenmasse | | | Ausladung A | Bohrung | | Halterbreite C | Anschlussschraube M | Ausführung |
|--------------------|--------------|-----|----|-------------|----------------|----------------|----------------|---------------------|------------|
| | t | a | r | | Grundbohrung B | aufbohrbar bis | | | |
| 43 DD 21 B 7-8 | 4 | 3 | 10 | 21 | 7 | 8 | 7 | M2 | G |
| 63 DD 23 B 7-8 | 6 | 3 | 15 | 23 | 7 | 8 | 7 | M3 | 5 |
| 84 DD 30 B 10 | 8 | 4 | 15 | 30 | 10 | | 8 | M4 | G/W |
| 84 DD 43 B 10 | 8 | 4 | 15 | 43 | 10 | | 8 | M4 | G/W |
| 85 DD 27 B 7-9 | 8 | 5 | 15 | 27 | 7 | 9 | 9 | M3 | G |
| 85 DD 32 B 10 | 8 | 5 | 15 | 32 | 10 | | 9 | M4 | G/W |
| 85 DD 43 B 10 | 8 | 5 | 15 | 43 | 10 | | 9 | M4 | G/W |
| 105 DD 37 B 10 | 10 | 5 | 16 | 37 | 10 | | 9 | M4 | G/W |
| 1064 DD 37 B 10 | 10 | 6,4 | 16 | 37 | 10 | | 11 | M4 | G/W |
| 12564 DD 40 B 10 | 12,5 | 6,4 | 20 | 40 | 10 | | 11 | M4 | G/W |
| 1258 DD 47 B 10-13 | 12,5 | 8 | 20 | 47 | 10 | 13 | 12 | M5 | G/W |
| 168 DD 46 B 10-13 | 16 | 8 | 20 | 46 | 10 | 13 | 12 | M5 | G/W |
| 168 DD 50 B 10-13 | 16 | 8 | 20 | 50 | 10 | 13 | 12 | M5 | G/W |
| 168 DD 62 B 13-16 | 16 | 8 | 25 | 62 | 13 | 16 | 12 | M5 | G/W |
| 1610 DD 50 B 10-16 | 16 | 10 | 25 | 50 | 10 | 16 | 14 | M5 | G/W |
| 1610 DD 62 B 13-16 | 16 | 10 | 25 | 62 | 13 | 16 | 14 | M5 | G/W |
| 208 DD 50 B 13-16 | 20 | 8 | 25 | 50 | 13 | 16 | 12 | M5 | G/W |
| 208 DD 60 B 13-16 | 20 | 8 | 25 | 60 | 13 | 16 | 12 | M5 | G/W |
| 2010 DD 50 B 10-13 | 20 | 10 | 25 | 50 | 10 | 13 | 14 | M5 | G/W |
| 2010 DD 60 B 13-16 | 20 | 10 | 25 | 60 | 13 | 16 | 14 | M5 | G/W |
| 2010 DD 70 B 16-20 | 20 | 10 | 30 | 70 | 16 | 20 | 14 | M5 | W |

| Bestell-Nr | Bürstenmasse | | | Ausladung A | Bohrung | | Halterbreite C | Anschlussschraube M | Ausführung |
|----------------------|--------------|------|----|-------------|----------------|----------------|----------------|---------------------|------------|
| | t | a | r | | Grundbohrung B | aufbohrbar bis | | | |
| 258 DD 60 B 13-16 | 25 | 8 | 25 | 60 | 13 | 16 | 12 | M5 | G/W |
| 2510 DD 60 B 13-16 | 25 | 10 | 25 | 60 | 13 | 16 | 14 | M6 | G/W |
| 2510 DD 70 B 16-20 | 25 | 10 | 30 | 70 | 16 | 20 | 14 | M6 | W |
| 25125 DD 60 B 13-16 | 25 | 12,5 | 25 | 60 | 13 | 16 | 17 | M6 | G/W |
| 25125 DD 70 B 16-20 | 25 | 12,5 | 30 | 70 | 16 | 20 | 17 | M6 | W |
| 25125 DD 80 B 16-20 | 25 | 12,5 | 30 | 80 | 16 | 20 | 17 | M6 | W |
| 25125 DD 90 B 16-20 | 25 | 12,5 | 30 | 90 | 16 | 20 | 17 | M6 | W |
| 2516 DD 85 B 16-20 | 25 | 16 | 30 | 85 | 16 | 20 | 22 | M8 | W |
| 3210 DD 67 B 13-16 | 32 | 10 | 32 | 67 | 13 | 16 | 15 | M6 | W |
| 3210 DD 80 B 13-20 | 32 | 10 | 32 | 80 | 13 | 20 | 15 | M6 | G/W |
| 32125 DD 70 B 16-20 | 32 | 12,5 | 32 | 70 | 16 | 20 | 17 | M6 | W |
| 32125 DD 80 B 16-20 | 32 | 12,5 | 32 | 80 | 16 | 20 | 17 | M6 | W |
| 32125 DD 90 B 16-20 | 32 | 12,5 | 32 | 90 | 16 | 20 | 17 | M6 | W |
| 32125 DD 100 B 16-20 | 32 | 12,5 | 32 | 100 | 16 | 20 | 17 | M6 | W |
| 3216 DD 85 B 16-20 | 32 | 16 | 32 | 85 | 16 | 20 | 22 | M8 | W |
| 3216 DD 100 B 16-20 | 32 | 16 | 32 | 100 | 16 | 20 | 22 | M8 | W |
| 40125 DD 95 B 16-20 | 40 | 12,5 | 40 | 95 | 16 | 20 | 17 | M8 | W |
| 4020 DD 100 B 16-20 | 40 | 20 | 40 | 100 | 16 | 20 | 26 | M10 | W |
| 4020 DD 125 B 25 | 40 | 20 | 40 | 125 | 25 | | 26 | M10 | W |
| 4020 DD 140 B 25 | 40 | 20 | 40 | 140 | 25 | | 26 | M10 | W |